

HYD CNC Technology CO.,LTD

Tel:+86-755-26625800

Fax:+86-755-26729960

www.hydcnc.com

# Capacitive Torch Height Controller CHC-200E Instruction

(Revision 2011)



地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园)

0755-26729960

TEL: 0755-26625800 FAX:

# **SAFETY:**

- Please read this manual fully before use CHC-200E
- ◆ DO NOT open cabinet of THC unless trained technician.
- DO NOT adjust the sealed resister.
- Turn off Powersupply if when THC is unused.
- ◆ DO NOT put liquid on THC.
- ◆ Attention Anti-dust work, DO NOT let metal dust into THC.
- DO NOT use on plasma over 100A or HF plasma

# **Installation Note:**

- ♦ CHC-200E uses AC24
- ◆ GND Port must be well grounded, GND resister≤1Ω.
- ◆ UP/DOWN on THC must be same to Z-axis Lifter

#### To Customer:

- ♦ We only supply to re-seller as CNC cutting machine manufacturer, engineering company... end-user please contact our local distributor for product supplying.
- **♦** We offer technical support to all distributors and users of our product.
- ◆ The product is under ONE year warranty since delivery, and enjoys life-long service and support.

# IMPORTANT NOTE:

All our THCs have been tested in our workshop before delivery, all commissioning work has been done. Please NOT change the setting without informing your supplier.

ShenZhen HYD CNC Technology CO.,LTD

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL:0755-26625800 FAX:

# 1 Intro

# 1.1 Basic specs

Power supply:

CHC-200E: AC24V±10%, 50Hz/60Hz;

• DC motor used on lifter:

CHC-200E: DC24V;

• Output current:

CHC-200E: 1A-4A, max: 100W;

Work temperature: THC-10 ∽ 60°C;

HF cable:  $-10 \le 200 \,^{\circ}\mathbb{C}$ ; Sensor parts:  $-10 \le 350 \,^{\circ}\mathbb{C}$ .

• Accuracy: ±0.1mm (matters with lifter design);

Auto height range: from cutting material surface 1mm — 20mm.

- Product size shows as figure 1-1

L\*W\*H: 176mm \* 105mm \* 50mm





Figure 1-1

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:

# 1.2 New features

Comparing to CHC-200D, CHC-200E has new features as follow,

- 1. Increased more indicators to shows different states of THC.
- Output of collision-alarm, which is optical isolation output from THC, can be sent to CNC's Alarm input to freeze machine's move. This signal is effective on both manual/auto mode. The max output is 200mA, capable to drive most relays.
- Anti-collision function. On manual/auto mode, when metal or low-conductive item like hand touches sensor ring, THC would send out collision signal and lift torch up until no collision exist.
- 4. When HF cable is disconnected or weakly connected, it would be indicated on the disconnection indicator. So after installation of HF cable, just shake the HF cable, the connection will be showed by the indicator.
- 5. Sensitive and Accuracy is increased 100%.
- 6. CHC200E uses digital logic control circuit for logic control, greatly improved anti-interference performance.

# 1.3 Work elements

CHC-200E work elements: It detects the distance between Sensor ring and the cutting material (steel, metal material) via detecting the capacitance between the two parts, and keep the two parts at a set distance by control the DC motor move. CHC-200E is a closed-loop control system, with 4 parts: Position Signal Sensing, Signal Process, Logic Control and Motor Drive.

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:

# 2 Components

# 2.1 For flame cutting

CHC-200E/300 full package includes follow parts: THC control module, socket connector, sensor ring, elastic connector, insulation part, fixture, HF cable. As figure 2-1shows,


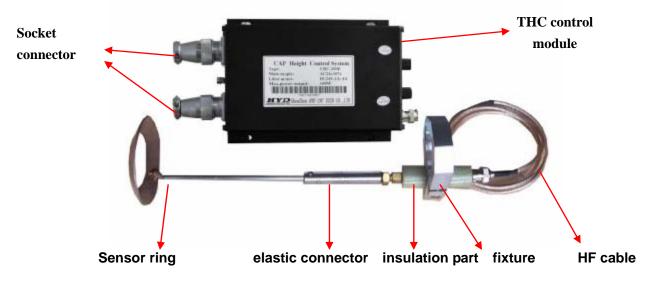


Figure 2-1

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:

# 3 THC control and connection

# 3.1 operation panel intro.

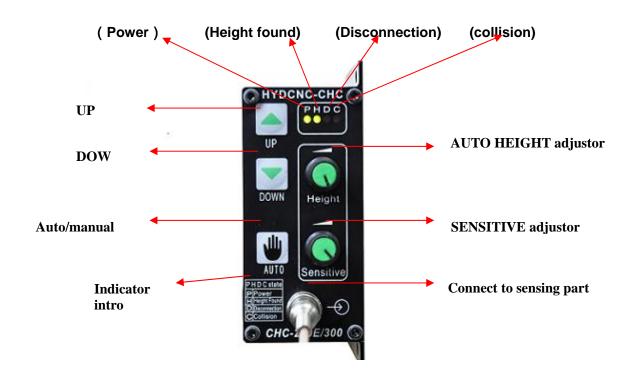

#### Indicators:

- **P Power:** Power indicator, red, Off means no power supply.
- **H Height Found:** Turn on when torch reaches auto height, green.
- **D Disconnection:** Disconnection indicator, red. When HF cable is unconnected or disconnected, it turns on. On auto mode, if disconnection happens, torch would keep lifting up until it's solved.
- **C Collision:** Turn red when sensor ring collision happens, both on manual/auto mode. Torch would keep lifting up until collision disappears. At this moment, press Down doesn't work. If HF cable short-connected with shield net, it is same as collision to THC.

# **Buttons on operation panel**

#### **Up/Down Button**

It is active on any mode. Priority is always given to Manual mode. For UP and Down, priority's given to UP. In case HF gets problem, it's always on UP mode, so the Down doesn't work.

#### **Auto Button**

Press the AUTO button, THC is always on Auto Mode, no matter there is a auto signal from outside

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL:0755-26625800 FAX:

or not. During cutting, THC needs to work on Auto Mode and it should be controlled by CNC, having nothing to do with this **Auto** button

# Height

It is used to adjust cutting torch height during Auto Mode. Height increases when it is turned clockwise. At the first commissioning, turn clockwise maximum to reach the highest height.

#### Sensitive

On Auto Mode, the Sensitive increases when it is turned clockwise.

# **Sensor ring Port**

One end of HF Cable link with the socket, the other end link with the sensor ring groupware

# 3.2 THC Connectors

As figure 3-2 shows, CHC-200E has only two connectors for installation, one is to CNC (X1-CNC), the other one is to lifter motor (X2-TORCH).

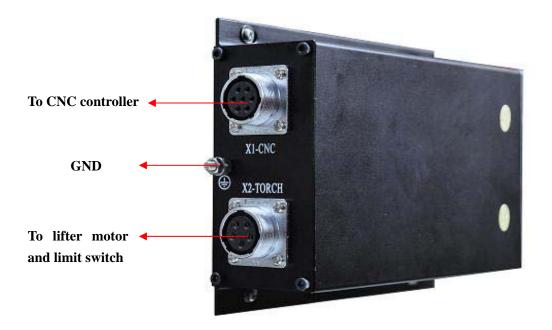


Figure 3-2

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:


# 3.2.1 \ X1- CNC ( TO CNC)

It is a 7-pin socket, pin definition as follow,

Pin	signal	Specs	
		CHC200E: AC24V	
1 , 2	POWER	CHC-300: AC/DC 24V	
		Collision output to CNC, OC door open	
3	Collision	output	
		Max drive current :200mA	
4	СОМ	I/O COM	
5	UP	Up control, low-level effective	
6	DOWN	Down control, low-level effective	
7	AUTO/MAN	Auto control, low-level effective	

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:

# 7-pin socket connection

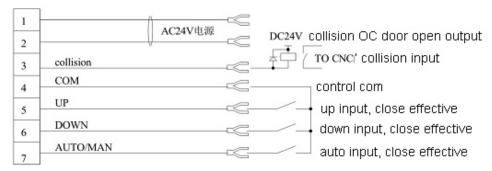


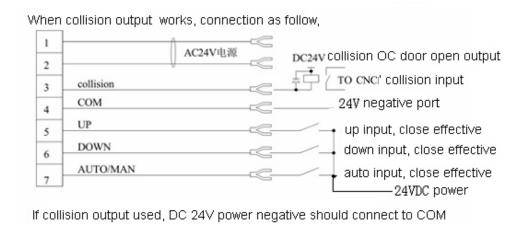



Figure 3-3

change JP3 Jumper position to control 24VDC input

CHC-200E to CNC (X1-CNC),input/output both use optical isolation, UP/DOWN/AUTO is external signal input to THC, Collision output from THC. All those signals share same COM. The input/output shows as Figure 3-4,

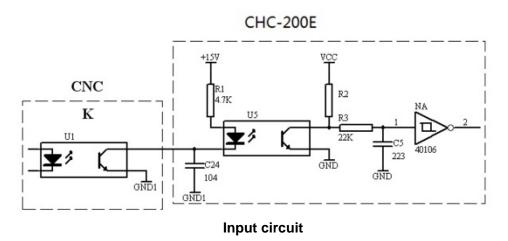

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:

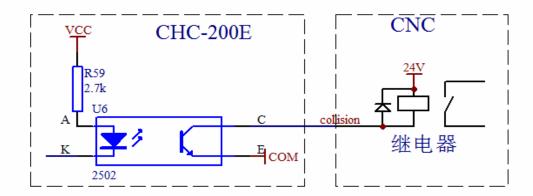

Output circuit Figure 3-4

# 3.2.2 X2-TORCH (to torch lifter motor)

It is a 5-pin socket, pin definition as follow,

Pin	signal	specs	
1 , 2	DC Motor Drive (Output)	DC motor connection Max 100W PWM	
3	LIMIT COM	Limit COM	
4	Down LIMIT (Input)	Down limit input Limit switch normally closed	
5	Up LIMIT (Input)	Up limit input Limit switch normally closed	

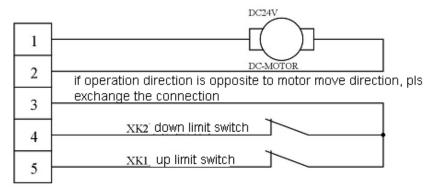


Figure 3-5

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:

#### Note:

- 1, Pin 1, 2 are DC motor connector, H bridge drive, PWM speed control.
- 2. CHC-200E limit switch must be normally closed contact, when one side limit is open, the move at this direction must be stopped, but the other direction move is still effective. Limit switch connection as figure 3-6.

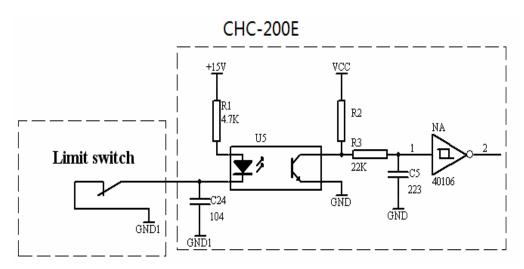



Figure 3-6 Limit input


地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:

#### 3.3 THC inside circuit instruction

THC inside circuit configuration as follow,

Balance point adjustor JP2 discon Jumper Frequency/current set Fuse

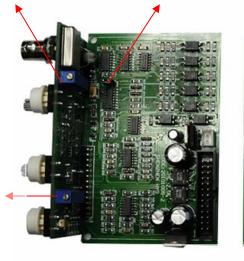

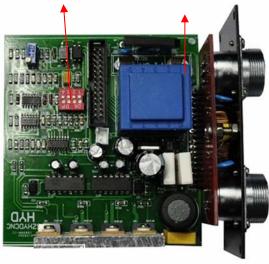

Disconnection adjustor

**CHC-200E** 

Figure 3-7

# 1. Balance point adjustor (R39)

It is to control THC find the balance point on Auto mode (balance point—torch stops at this position when it reaches the set auto height). This adjustor has passed commissioning before delivery, so no need user's adjusting. Unless the sensor ring installation changes or HF cable changes.

#### 2. Disconnection protection adjustor

On auto mode, lift torch up when HF cable disconnected to protect torch. It has been set well before delivery, no need user's adjusting, unless HF cable length changed.

#### 3. JP2 disconnection protection jumper

Disconnection protection is non-effective when it is un-plugged. Testing as follow, disconnect HF cable, press Auto button, if JP2 plugged torch lift up, if un-plugged, torch lift down. The original setting is JP2 PLUGGED, when the indicator (Disconnection) turns on, and THC is on Auto mode, torch would lift up.

#### 4. Drive Frequency and Current set:

Motor drive circuit is H Bridge Circuit, and adjust speed via PWM.

PWM frequency changed between 9KHz and 18KHz, controlled by SP2, showed as figure 3-7. Usually when motor is below 30W, we use 18KHz, when motor is above 30W, we use 9KHz, the original set is 9KHz.

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL:0755-26625800 FAX:

Current feedback circuit as follow,

Current	1-8	2-7	3-6	4-5
4A	OFF :	OFF	OFF	OFF
3A	PWM=9KHZ	OFF	OFF	ON
2A	ON :	OFF	ON	ON
1A	PWM=18KHZ	ON	ON	ON

Figure 3-8

# 4. Installation and Commissioning.

# 4.1

# 4.1.1 Sensor ring installation

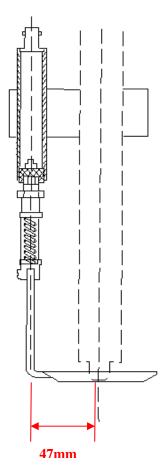


Figure 4-1 flame cutting installation

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL:0755-26625800 FAX:

**HYD** 

Installation of sensor ring: According to our years practice, sensor ring should be installed lower about 1∞2mm than torch head to avoid the edge effect during cutting edge of workpiece, and it anti-collision more effectively, as showed in Figure 4-1.

While on plasma cutting, the sensor ring shall be installed little higher than the torch head, to avoid the effect of plasma arc voltage, and it needs a special insulation part supplied from HYD.

# 4.2 Commissioning.

#### 4.2.1 Test after installation

Up/Down connects with GND, motor moves up and down, firstly make sure on Manual mode, torch up/down is same direction as Up/Down control button.

Auto/Manual connects with GND, THC is on Auto Mode. When it is open, the manual mode is active.

On Auto mode, if the sensor ring is not connected with THC and THC is under disconnection protection, the indicator Disconnection would turn on, cutting torch would keep lifting up. If sensor ring is connected with THC, the cutting torch should stop at a position via adjusting the **Height** button (THC finds the Auto Height),

On Auto Mode, the height of cutting torch is under control of **Height** button. At first commission, always turn clockwise maximum to get the highest height, then turn anti-clockwise, the height decreases. In case over adjusted, cutting torch touches the workpiece; motor will be on a shocking-state.

THC always drives motor to make sensor ring close to the Balance Position (the set Auto Height), and it stops when ring is around the Balance Position, 0.1m lower or higher). The closer, the more slowly the motor runs.

Auto sensitivity meets the request of THC when sensor ring is 5—20mm away from workpiece.

# 4.2.2 Commissioning when THC meets problem

# A. Disconnection and Collission

#### Disconnection

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL:0755-26625800 FAX:

When installation is well done, but Disconnection indicator is on, it means THC is under disconnection protection, can not work under auto mode. In this situation, user should have changed a longer HF cable, or a different cable not meet THC's request, the commission work as follow,

Disconnect HF cable with THC, the indicator keeps ON, connect it back.

And if disconnect HF cable at the other side, indicator still is ON. If not ON, then turn R47 Anti-clockwise till the indicator turns on.

Connect the HF cable back, if the indicator is not turn off, then turn R47 clock-wise till it turns off.

#### Collision

CHC-200E has Anti-collision function, it is effective on both manual/auto mode. When steel or other conductive item touches sensor ring, torch lift up, and the collision signal is sent out from the Pin3 of 7-pin socket(OC door), when CNC receives this signal, machine pauses and waits for treatment of collision. When collision happens, the C indicator(collision) on operation panel turns on, shows as figure 4-2,

When manually press Down button, sensor ring touches steel, the C indicator flashes, torch will move up/down on steel.

Normally human's hand touches sensor ring, C indicator would turn on and send out collision signal.

If user changes HF cable, or HF cable spec changes, C indicator might turn on, like follow situation, HF cable short-circuit, once it happens, C indicator turns on, torch lift up. It could be confirmed by checking the HF cable shield net and Signal connect or not.

HF cable gets longer, it needs to adjust R39 to find the Balance point, then THC can work right on Auto mode, and C indicator will turn off.



Figure 4-2 collision happens"C" indicator is on

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX:

#### B. None collision or disconnection

As the difference of cutting torch, THC can not find the Balance Position in all range of Height adjustor, torch keeps lifting up or down. In this situation, DO NOT open the THC cabinet, just do it as follow introduction, shows as Figure 4-3.



Figure 4-2

#### Note: Firstly to confirm the two situations when torch keeps lifting up before adjusting

- On auto mode, THC controls torch up/down to find the Balance point, if the Auto height is set too high, torch would keep lifting up. Manual control torch down is effective, because Manual control has priority against Auto Control. In this situation it needs to adjust the Height Button, further adjust R39.
- 2. On auto mode, when HF cable is disconnected or short-connected, or collision happens, THC lifts torch up for protection, Manual control down is non-effective. This Up has priority against Down.

In situation 1, Press AUTO button and hold, turn Height button clockwise maximum. Then, motor would control sensor moves, please turn Height button left/right, torch should stop at some position (Balance Point—Auto Height). If not, please use a small screwdriver to adjust R39 as follow step, (no need to open THC cabinet, just the screwdriver passes the small hole).

First, set on Manual mode, lift torch up over 50mm against steel plate.

Press Auto button to turn Auto on, if torch lift down, means Auto Height is too low, then adjust R39 clockwise to raise the auto height. If torch lift up, means Auto height is too high, turn anti-clockwise

Please protect the adjust Resistor to avoid damage, Do Not exceed 1/4 round on every turn, and make record of turn direction.

Every time after turned R39, turn Auto mode on, to check the torches move for Balance Point.

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL:0755-26625800 FAX:

When torch can stops at a set height by adjusting R39, then turn Height button to set the Auto height at right high on Auto mode.

Note: The THC has passed all commissioning work before delivery, please NOT adjust the inside resistor without informing your supplier.

The adjustable resistor spec

Mark no	spec	function	
R39	1K	Auto height adjusting	
R47	20K	Disconnection protection	

地址:深圳市南山区西丽留仙洞关外 20 号厂房 6 楼 6-4(福新发工业园) TEL: 0755-26625800 FAX: